

Coleman Creek Consulting, Inc.

DRINKING WATER LEAD SAMPLING
OF
EARLY CHILDHOOD SERVICES ESD FACILITY
1021 NW HIGHLAND AVENUE, GRANTS PASS, OREGON
FOR
SOUTHERN OREGON EDUCATION SERVICE DISTRICT

INTRODUCTION

Coleman Creek Consulting, Inc. (CCC) was retained by the Southern Oregon Education Service District (SOESD) to perform representative lead drinking water sampling of the Early Childhood Services ESD Facility at the above address. The purpose of the lead drinking water sampling was to determine the concentration of lead in representative drinking water sources and compare with regulatory standards. In 2017, Education Service Districts were required to adopt a Healthy and Safe Schools Plan, including provisions for testing and reducing exposure to elevated levels of lead in water used for drinking and food preparation.

LEAD DRINKING WATER SAMPLING REQUIREMENTS


Guidelines for sampling lead in water were established by the Oregon Health Authority. Water sampling is to occur after water sits overnight in the pipes without being used, and must be sampled after a day occupied by students or building occupants. All water sources are to be sampled, with the exception of water used for heating, sanitation, irrigation, and science sinks for grades 6 and up with non-potable water signs. Initial testing is required to be performed by 2020, and every 6 years thereafter, according to a testing schedule determined by the Oregon Department of Education.

DRINKING WATER SAMPLING

David W. Fawcett of CCC visited the Early Childhood ESD Facility on October 5, 2019. Mr. Fawcett collected a lead drinking water sample from the drinking water sources identified in the facility. See Site Sample Record Sheets (page 3) for a description of the drinking water sources sampled. See Drinking Water Sample Location Diagram in Appendix A for a visual review of all drinking water sample locations. The drinking water samples were collected in the early morning, ensuring that the sample source had not been in use since the previous day. The sample was placed in a cooler and transported to Neilson Research Corporation for lead analysis.

DRINKING WATER LEAD RESULTS AND TESTING SUMMARY SHEET

The Ten (10) drinking water samples collected were analyzed for lead using EPA Method 200.8. See Neilson Research Corporation Analytical Report in Appendix B. The Drinking Water Testing Summary Sheets (pages 4-5) indicates the lead in drinking water concentrations of the ten (10) samples

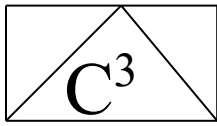

Coleman Creek Consulting, Inc.

collected from the Early Childhood Services facility were reported ranging from <0.5 to 6.54 parts per billion (ppb).


CONCLUSIONS

Ten (10) drinking water locations were sampled from drinking water sources at the Early Childhood Services ESD Facility prior to use that day by building occupants, and after a day the facility was occupied. All ten (10) of the sample locations were reported with concentrations below the 15 ppb lead action level in water.

RECOMMENDATIONS

Coleman Creek Consulting, Inc. recommends future drinking water sampling at the Early Childhood Services ESD Facility according to the schedule set out by the Oregon Department of Education. Coleman Creek Consulting, Inc. appreciates the opportunity to continue to perform environmental sampling and consulting services to Southern Oregon Education Service District.

David W. Fawcett
Director of Consulting Services

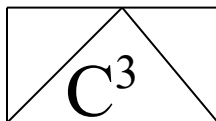

Coleman Creek Consulting, Inc.


DRINKING WATER LEAD SAMPLE RECORD SHEET

FACILITY: Early Childhood Services
ADDRESS: 1021 NW Highland
Grants Pass, Oregon

DATE: 09-11-25
SAMPLER: David W. Fawcett

SAMPLE #	SOURCE DESCRIPTION	LOCATION	COLLECTION TIME
25-004G.ECS1	Sink Faucet	Cedar Classroom Sink	0608
25-004G.ECS3	Sink Faucet	Red Classroom Bath Small Sink	0610
25-004G.ECS4	Sink Faucet	Red Classroom Bath Large Sink	0611
25-004G.ECS5	Sink Faucet	Willow Classroom Kitchen Sink	0612
25-004G.ECS6	Sink Faucet	Willow Classroom Sink	0615
25-004G.ECS7	Sink Faucet	Classroom Hall Bath	0619
25-004G.ECS9	Sink Faucet	1 st Floor Hall Bath Right Sink	0624
25-004G.ECS10	Sink Faucet	1 st Floor Kitchen Sink	0626
25-004G.ECS11	Filtered Dispenser	1 st Floor Kitchen Sink	0627
25-004G.ECS12	Sink Faucet	Bungalow Bath Cold Water	0630

Sample locations corresponding to ECS2, ECS8, ECS13, and ECS14 water sources were discontinued.

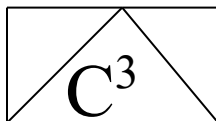

Coleman Creek Consulting, Inc.

DRINKING WATER TESTING SUMMARY SHEET


DISTRICT NAME: Southern Oregon Education Service District
DISTRICT ID#: 2025
SCHOOL NAME: Early Childhood Services
BUILDING NAME: ECS Main Building
BUILDING ID#: 20250008

Sample Number	Fixture Location Description	Fixture ID#	Test Date	Test Result (ppb)	# Retest	Final Result (ppb)
25-004G.ECS1	Cedar Classroom	CF	09-11-19	0.506		
25-004G.ECS3	Red Classroom - Small	BF	10-11-19	0.796		
25-004G.ECS4	Red Classroom - Large	BF	10-11-19	2.75		
25-004G.ECS5	Willow Class Kitchen	KF	10-11-19	0.598		
25-004G.ECS6	Willow Classroom	CF	10-11-19	1.30		
25-004G.ECS7	Classroom Hall Bath	DW	10-05-19	0.5		
25-004G.ECS9	1 st Floor Hall Bath, Right	BF	10-05-19	6.54		
25-004G.ECS10	1 st Floor Kitchen	KF	10-05-19	<0.5		
25-004G.ECS11	1 st Floor Kitchen, Filtered	KF	10-05-19	<0.5		

Fixture ID Coding:

DW = Drinking Water Fountain WC = Water Cooler WB = Water Bottle Filler
CF = Classroom Faucet BF = Bathroom Faucet SF = Staff/Office Faucet
KF = Kitchen/Food Prep OS = Outside Spigot OT = Other (Specify)

Previous sample #'s ECS2, ECS8 and ECS12 all deleted drinking water sources.

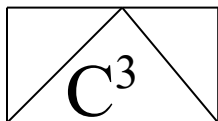

Coleman Creek Consulting, Inc.

DRINKING WATER TESTING SUMMARY SHEET

DISTRICT NAME: Southern Oregon Education Service District
DISTRICT ID#: 2025
SCHOOL NAME: Early Childhood Services
BUILDING NAME: ECS Office Building
BUILDING ID#: 20250009

Sample Number	Fixture Location Description	Fixture ID#	Test Date	Test Result (ppb)	# Retest	Final Result (ppb)
25-004G.ECS12	Bath Faucet	BF	09-11-25	0.594		

Fixture ID Coding:

DW = Drinking Water Fountain WC = Water Cooler WB = Water Bottle Filler
CF = Classroom Faucet BF = Bathroom Faucet SF = Staff/Office Faucet
KF = Kitchen/Food Prep OS = Outside Spigot OT = Other (Specify)


Sample ECS13 permanently deleted.

APPENDIX A

**DRINKING WATER SAMPLE LOCATION
DIAGRAMS**

DRINKING WATER SAMPLE LOCATION DIAGRAM

ECS Classroom Building - 1021 NW Highland, Grants Pass

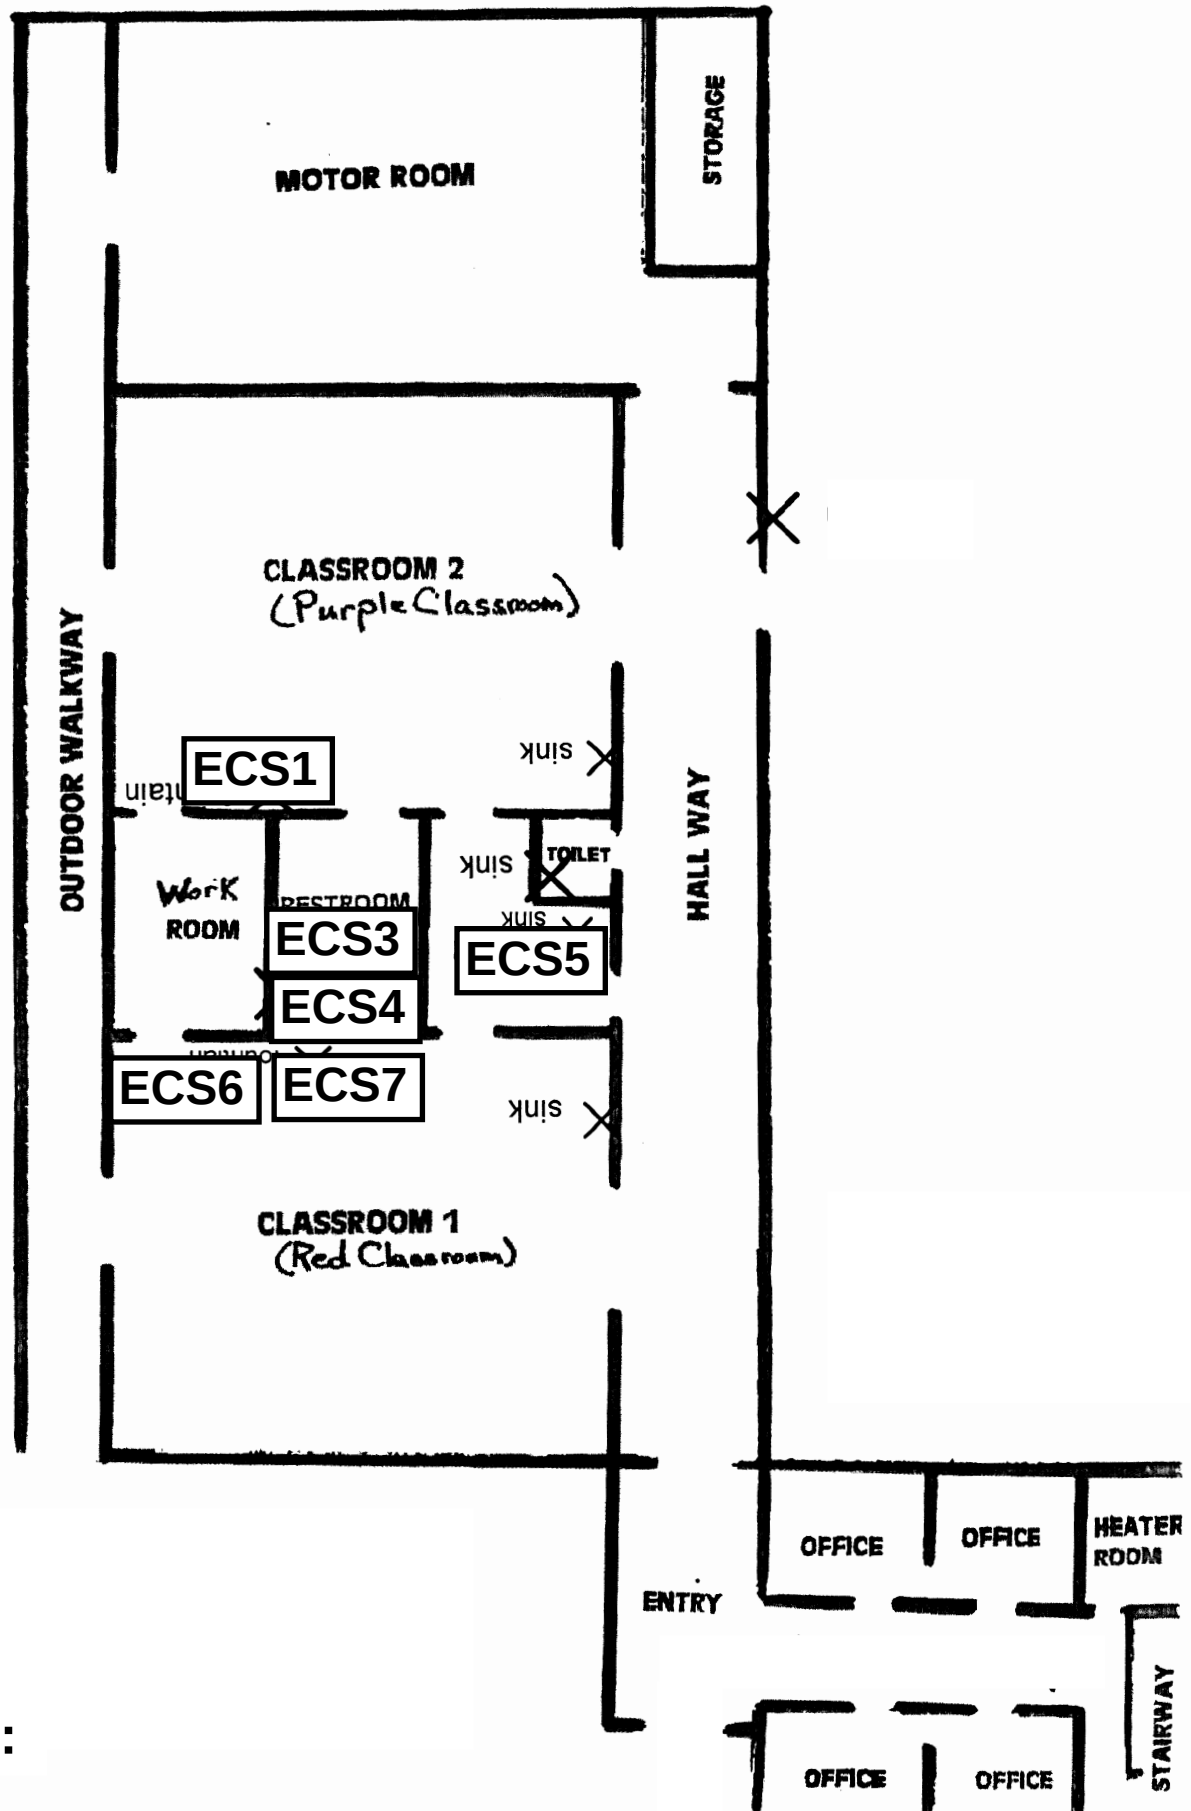


LEGEND:

ECS3 = Drinking Water Sample Location

DRINKING WATER SAMPLE LOCATION DIAGRAM

ECS Upstairs Building - 1021 NW Highland, Grants Pass

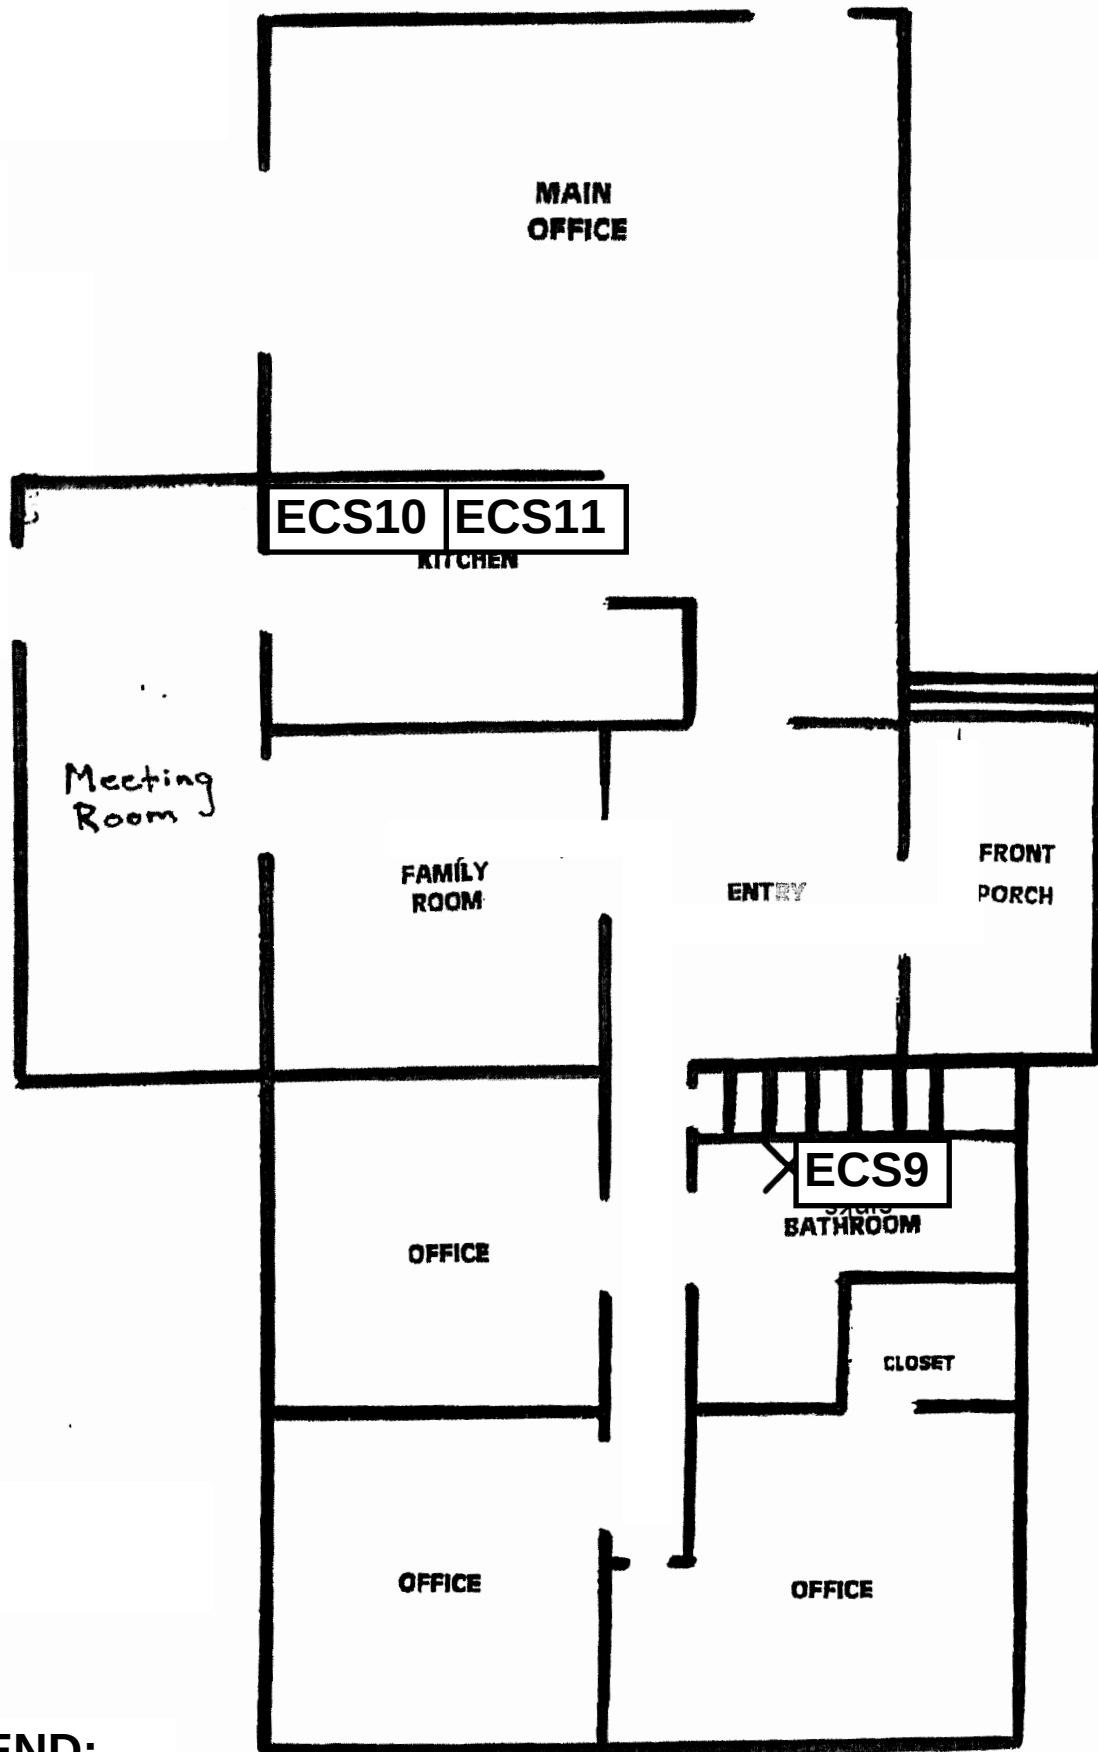


LEGEND:

ECS8 = Drinking Water Sample Location

DRINKING WATER SAMPLE LOCATION DIAGRAM

ECS Bungalow - 1021 NW Highland, Grants Pass

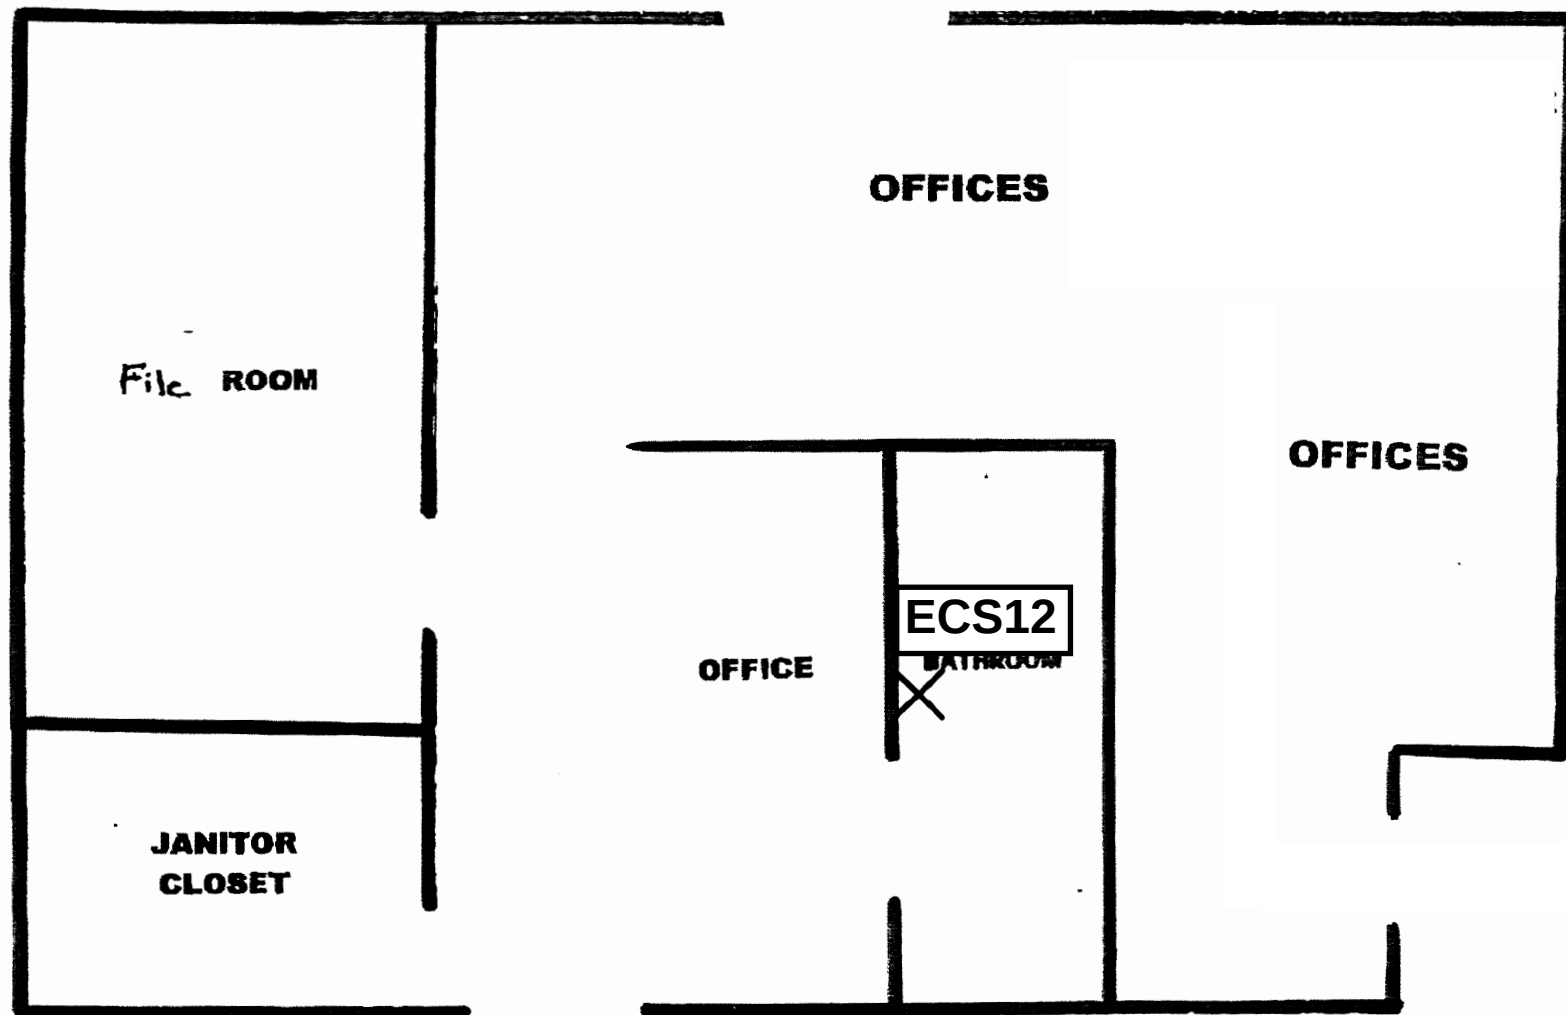

LEGEND:

ECS12 = Drinking Water Sample Location

APPENDIX B

NEILSON RESEARCH CORPORATION ANALYTICAL REPORT



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

September 22, 2025

Dave Fawcett
Coleman Creek Consulting
810 Leonard St
Ashland, OR 97520
TEL: (541) 535-7108
FAX (541) 535-8795

RE: 25-004G ECS

Order No.: 25090628

Dear Dave Fawcett:

Neilson Research Corporation received 10 sample(s) on 9/12/2025 for the analyses presented in the following report.

The results relate only to the parameters tested or to the sample as received by the laboratory. This report shall not be reproduced except in full, without the written approval of Neilson Research Corporation. If you have any questions regarding these test results, please feel free to call.

Sincerely,
Neilson Research Corporation

Tamra Schmedemann
Director of Project Management
245 S Grape St
Medford, OR 97501



Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

Case Narrative

WO#: 25090628
Date: 9/22/2025

CLIENT: Coleman Creek Consulting
Project: 25-004G ECS

The analyses were performed according to the guidelines in the Neilson Research Corporation Quality Assurance Program. This report contains analytical results for the sample(s) as received by the laboratory.

Neilson Research Corporation certifies that this report is in compliance with the requirements of NELAP. No unusual difficulties were experienced during analysis of this batch except as noted below or qualified with data flags on the reports.

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

Analytical Report

WO#: 25090628

Date Reported: 9/22/2025

Coleman Creek Consulting
810 Leonard St
Ashland, OR 97520

Lab Order: 25090628
Received Date: 9/12/2025 8:36:00 AM
Reported Date: 9/22/2025 2:18:56 PM

Sample Information:

Lab ID: 25090628-01 **Client Sample ID:** 25-004G.ECS1
Collection Date: 9/11/2025 6:08:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst; KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	0.506		0.500	ppb	1	9/15/2025	15.0	A

Lab ID: 25090628-02 **Client Sample ID:** 25-004G.ECS3
Collection Date: 9/11/2025 6:10:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst; KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	0.796		0.500	ppb	1	9/15/2025	15.0	A

Lab ID: 25090628-03 **Client Sample ID:** 25-004G.ECS4
Collection Date: 9/11/2025 6:11:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst; KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	2.75		0.500	ppb	1	9/15/2025	15.0	A

QUALIFIERS	*	Value exceeds Maximum or Minimum Contaminant Level.	C1	Sample container temperature is out of limit as specified at testcode
	DF	Dilution Factor	E	Value above quantitation range
	H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
	MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
	R	RPD outside accepted recovery limits	RL	Reporting Limit

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

Analytical Report

WO#: 25090628

Date Reported: 9/22/2025

Coleman Creek Consulting
810 Leonard St
Ashland, OR 97520

Lab Order: 25090628
Received Date: 9/12/2025 8:36:00 AM
Reported Date: 9/22/2025 2:18:56 PM

Sample Information:

Lab ID: 25090628-04 **Client Sample ID:** 25-004G.ECS5
Collection Date: 9/11/2025 6:12:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst; KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	0.598		0.500	ppb	1	9/16/2025	15.0	A

Lab ID: 25090628-05 **Client Sample ID:** 25-004G.ECS6
Collection Date: 9/11/2025 6:15:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst; KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	1.36		0.500	ppb	1	9/16/2025	15.0	A

Lab ID: 25090628-06 **Client Sample ID:** 25-004G.ECS7
Collection Date: 9/11/2025 6:19:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst; KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	ND		0.500	ppb	1	9/16/2025	15.0	A

QUALIFIERS	*	Value exceeds Maximum or Minimum Contaminant Level.	C1	Sample container temperature is out of limit as specified at testcode
	DF	Dilution Factor	E	Value above quantitation range
	H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
	MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
	R	RPD outside accepted recovery limits	RL	Reporting Limit

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

Analytical Report

WO#: 25090628
Date Reported: 9/22/2025

Coleman Creek Consulting
810 Leonard St
Ashland, OR 97520

Lab Order: 25090628
Received Date: 9/12/2025 8:36:00 AM
Reported Date: 9/22/2025 2:18:56 PM

Sample Information:

Lab ID: 25090628-07 **Client Sample ID:** 25-004G.ECS9
Collection Date: 9/11/2025 6:24:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS							Analyst; KN	
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	6.54		0.500	ppb	1	9/16/2025	15.0	A

Lab ID: 25090628-08 **Client Sample ID:** 25-004G.ECS10
Collection Date: 9/11/2025 6:26:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS							Analyst; KN	
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	ND		0.500	ppb	1	9/16/2025	15.0	A

Lab ID: 25090628-09 **Client Sample ID:** 25-004G.ECS11
Collection Date: 9/11/2025 6:27:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS							Analyst; KN	
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	ND		0.500	ppb	1	9/16/2025	15.0	A

QUALIFIERS	*	Value exceeds Maximum or Minimum Contaminant Level.	C1	Sample container temperature is out of limit as specified at testcode
	DF	Dilution Factor	E	Value above quantitation range
	H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
	MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
	R	RPD outside accepted recovery limits	RL	Reporting Limit

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

Analytical Report

WO#: 25090628

Date Reported: 9/22/2025

Coleman Creek Consulting
810 Leonard St
Ashland, OR 97520

Lab Order: 25090628
Received Date: 9/12/2025 8:36:00 AM
Reported Date: 9/22/2025 2:18:56 PM

Sample Information:

Lab ID: 25090628-10 **Client Sample ID:** 25-004G.ECS12
Collection Date: 9/11/2025 6:30:00 AM **Collected By:** Dave Fawcett
Matrix: Drinking Water **Sample Location:** Grab

Trace Metals by EPA 200.8 ICP-MS						Analyst: KN		
Analyses	Result	Qual	MRL	Units	DF	Date Analyzed	MCL	NELAP Status
Lead	0.594		0.500	ppb	1	9/16/2025	15.0	A

QUALIFIERS	*	Value exceeds Maximum or Minimum Contaminant Level.	C1	Sample container temperature is out of limit as specified at testcode
	DF	Dilution Factor	E	Value above quantitation range
	H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
	MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
	R	RPD outside accepted recovery limits	RL	Reporting Limit

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 25090628
22-Sep-25

Client: Coleman Creek Consulting
Project: 25-004G ECS

TestCode: LEAD_SCHOOLS

Sample ID: MB-32880	SampType: MBLK	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/15/2025	RunNo: 62727
Client ID: PBW	Batch ID: 32880	TestNo: E200.8	E200.8	Analysis Date: 9/15/2025	SeqNo: 1036339
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	ND	0.500			
------	----	-------	--	--	--

Sample ID: LCS-32880	SampType: LCS	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/15/2025	RunNo: 62727
Client ID: LCSW	Batch ID: 32880	TestNo: E200.8	E200.8	Analysis Date: 9/15/2025	SeqNo: 1036340
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	97.0	0.500	100	0	97.0 85 115
------	------	-------	-----	---	-------------

Sample ID: 25090621-01AMS	SampType: MS	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/15/2025	RunNo: 62727
Client ID: BatchQC	Batch ID: 32880	TestNo: E200.8	E200.8	Analysis Date: 9/15/2025	SeqNo: 1036342
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	116	0.500	100	23.0	93.2 70 130
------	-----	-------	-----	------	-------------

Sample ID: 25090621-01AMSD	SampType: MSD	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/15/2025	RunNo: 62727
Client ID: BatchQC	Batch ID: 32880	TestNo: E200.8	E200.8	Analysis Date: 9/15/2025	SeqNo: 1036343
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	114	0.500	100	23.0	91.3 70 130 116 1.71 20
------	-----	-------	-----	------	-------------------------

Qualifiers: C1 Sample container temperature is out of limit as specified at testcode DF Dilution Factor H Holding times for preparation or analysis exceeded
MI Recovery outside control limits due to Matrix Interference ND Not Detected at the Reporting Limit RL Reporting Limit

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 25090628
22-Sep-25

Client: Coleman Creek Consulting
Project: 25-004G ECS

TestCode: LEAD_SCHOOLS

Sample ID: MB-32898	SampType: MBLK	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/16/2025	RunNo: 62752
Client ID: PBW	Batch ID: 32898	TestNo: E200.8	E200.8	Analysis Date: 9/16/2025	SeqNo: 1036848
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	ND	0.500			
------	----	-------	--	--	--

Sample ID: LCS-32898	SampType: LCS	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/16/2025	RunNo: 62752
Client ID: LCSW	Batch ID: 32898	TestNo: E200.8	E200.8	Analysis Date: 9/16/2025	SeqNo: 1036849
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	96.4	0.500	100	0	96.4 85 115
------	------	-------	-----	---	-------------

Sample ID: 25090628-04AMS	SampType: MS	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/16/2025	RunNo: 62752
Client ID: 25-004G.ECS5	Batch ID: 32898	TestNo: E200.8	E200.8	Analysis Date: 9/16/2025	SeqNo: 1036851
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	98.3	0.500	100	0.598	97.7 70 130
------	------	-------	-----	-------	-------------

Sample ID: 25090628-04AMSD	SampType: MSD	TestCode: LEAD_SCHO	Units: ppb	Prep Date: 9/16/2025	RunNo: 62752
Client ID: 25-004G.ECS5	Batch ID: 32898	TestNo: E200.8	E200.8	Analysis Date: 9/16/2025	SeqNo: 1036852
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Lead	98.2	0.500	100	0.598	97.6 70 130 98.3 0.0611 20
------	------	-------	-----	-------	----------------------------

Qualifiers: C1 Sample container temperature is out of limit as specified at testcode DF Dilution Factor H Holding times for preparation or analysis exceeded
MI Recovery outside control limits due to Matrix Interference ND Not Detected at the Reporting Limit RL Reporting Limit

Original



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

Sample Log-In Check List

Client Name: ColemanCreek

Work Order Number: 25090628

RcptNo: 1

Logged by: Ashley Spiegelberg 9/12/2025 8:36:00 AM

Completed By: Coni Boyko 9/17/2025 10:36:10 AM

Reviewed By: Ashley Spiegelberg 9/22/2025 2:16:21 PM

Am
Coni Boyko
Am

Chain of Custody

1. Is Chain of Custody complete? Yes ☒ No ☐ Not Present ☐
2. How was the sample delivered? Client

Log In

3. Coolers are present? Yes ☐ No ☐ NA ☒
4. Shipping container/cooler in good condition? Yes ☒ No ☐
Custody seals intact on shipping container/cooler? Yes ☐ No ☐ Not Present ☒ NA ☐
No. Seal Date: Signed By:
5. Was an attempt made to cool the samples? Yes ☐ No ☒ NA ☐
6. Were all samples received at a temperature of >0° C to 6.0°C Yes ☐ No ☐ NA ☒
7. Sample(s) in proper container(s)? Yes ☒ No ☐
8. Sufficient sample volume for indicated test(s)? Yes ☒ No ☐
9. Are samples (except VOA and ONG) properly preserved? Yes ☒ No ☐
10. Was preservative added to bottles? Yes ☐ No ☒ NA ☐
11. Is the headspace in the VOA vials less than 1/4 inch or 6 mm? Yes ☐ No ☐ No VOA Vials ☒
12. Were any sample containers received broken? Yes ☐ No ☒
13. Does paperwork match bottle labels?
(Note discrepancies on chain of custody) Yes ☒ No ☐
14. Are matrices correctly identified on Chain of Custody? Yes ☒ No ☐
15. Is it clear what analyses were requested? Yes ☒ No ☐
16. Were all holding times able to be met?
(If no, notify customer for authorization.) Yes ☒ No ☐

Special Handling (if applicable)

17. Was client notified of all discrepancies with this order? Yes ☐ No ☐ NA ☒

Person Notified: Date
By Whom: Via: ☐ eMail ☐ Phone ☐ Fax ☐ In Person
Regarding:
Client Instructions:

18. Additional remarks:

Cooler Information

Cooler No	Temp °C	Condition	Seal Intact	Seal No	Seal Date	Signed By
-----------	---------	-----------	-------------	---------	-----------	-----------

Chain of Custody Record

This Chain of Custody is a LEGAL DOCUMENT and must be filled out accurately.

Section A

Required Client Information

Company:	Coleman Creek Consulting
Address:	810 Leonard St Ashland, OR 97520
Email:	fawbro@ccountry.net
Phone:	Fax:
Collected By (Print):	Dave Fawcett
Collected By (Sign):	<i>[Signature]</i>
Email Report ☒	Mail Report ☐ Fax Report ☐

Section B

Required Project Information

Project Name:	ECS
Project Number:	25-0046
Report To:	Dave Fawcett
Copy To:	

Section C

Invoice Information

Attention:	
Company Name:	
Address:	
P.O. #	

Section D

Rush Status (Subject to Scheduling)

☒ Standard: 10 Business Days
☐ Priority: 5 Business Days (List x 1.50)
☐ Express: 3 Business Days (List x 1.75)
☐ Rush: 2 Business Days (List x 2.00)
☐ Rush: 1 Business Day (List x 2.50)
☐ Rush: Same Day (List x 3.00)
Authorized ☐ Yes ☐ No

Section E

Sample Information

Sample ID	Comp/Grab	Matrix*	Date Collected	Time Collected	No. of Containers	Analysis Requested										NRC Workorder # (Lab Use Only)	Remarks / Field Data	NRC Sample # (Lab Use Only)	(Lab
25-0046, ECS1	Grab	DW	9-11-25	0608	1	Total Lead										25090628		01	
ECS 2				0610	1													02	
ECS 3				0611	1													03	
ECS 4				0612	1													04	
ECS 5				0615	1													05	
ECS 6				0619	1													06	
ECS 7				0624	1													07	
ECS 8				0626	1													08	
ECS 9				0627	1													09	
ECS 10				0630	1													10	

*Matrix: DW - Drinking Water WW - Wastewater W - Water S - Soil/Solid SL - Sludge O - Oil WP - Wipe OT - Other

Section F

Relinquish/Receive

Relinquished By:	<i>[Signature]</i>	Sign	David Fawcett	Print	Date	9-12-25	Time	0836
Received By:								
Relinquished By:								
Received By:								
Relinquished By:								
Received By Laboratory:	<i>[Signature]</i>		Ashley Siegelberg		9/12/25		8:36	

Section G

Lab Use Only

Temp: <i>4mb</i>	IR Therm ID: <i>NA</i>
≤6°C: ☐ Yes ☐ No	
Received on Ice: ☐ Yes ☒ No	
Number of Bottles Received:	
pH Checked: ☒	
COC Seals Intact: ☐ Yes ☐ No ☐ NA	
Field Blank Included: ☐ Yes ☒ No	
Received Via ☐ UPS ☐ FedEx ☐ Other ☒ Hand	

Payment: ☒ Invoice ☐ Cash ☐ VISA, M/C ☐ Check # ☐ Amount ☐